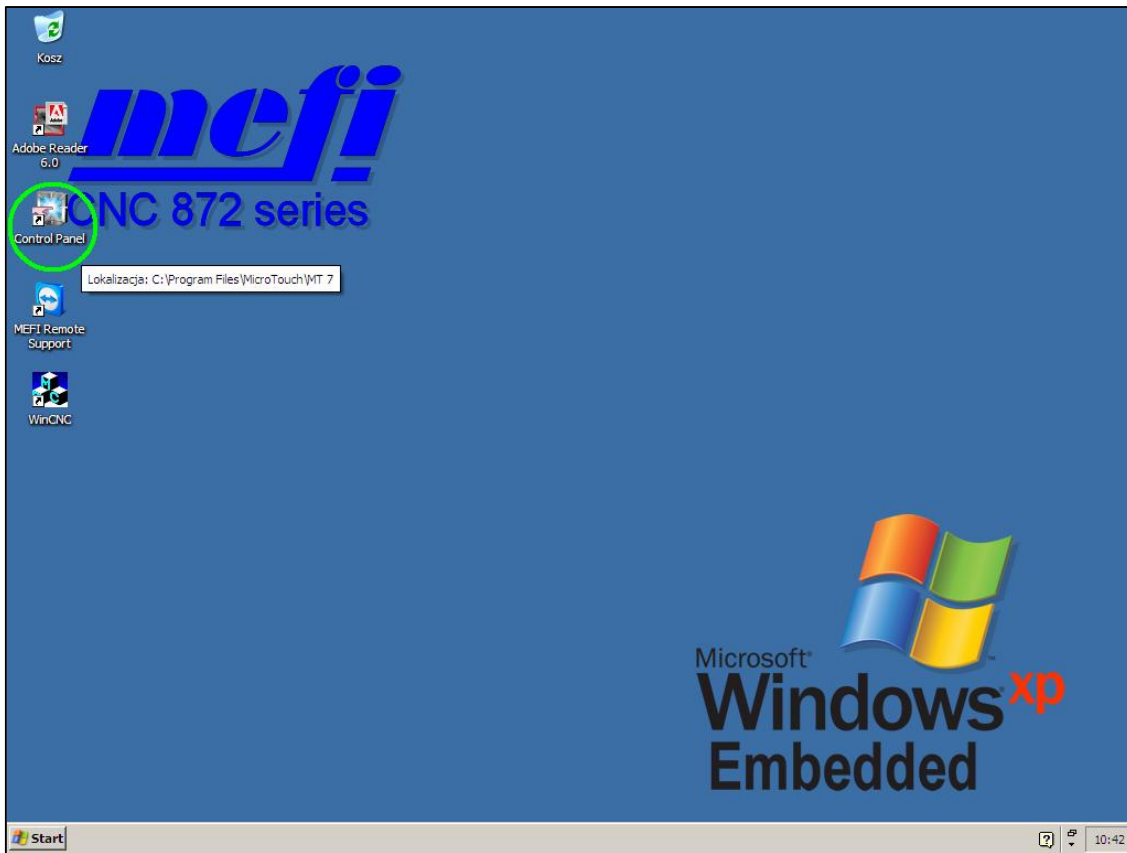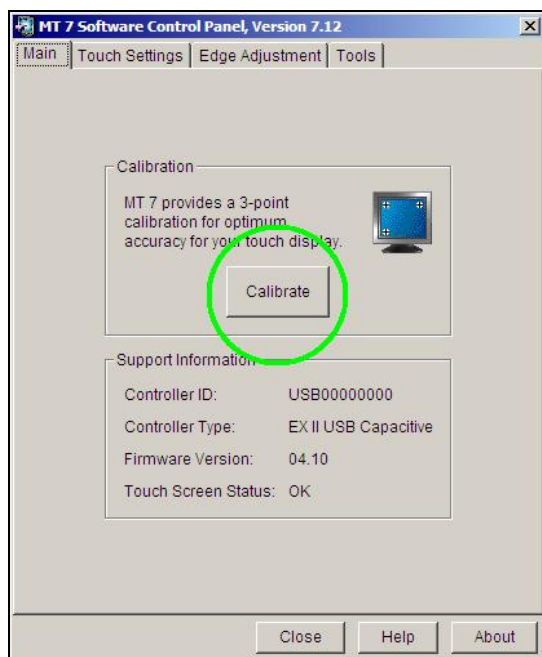# Appendix A - Touch Screen Settings
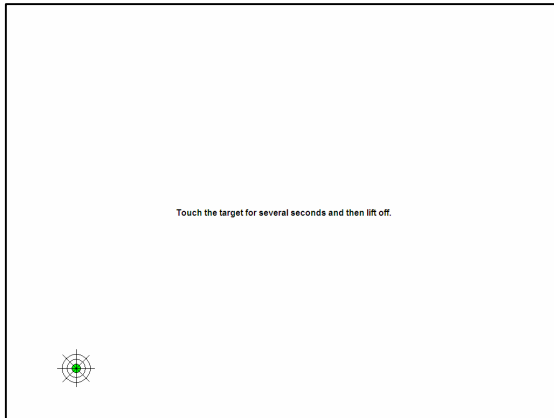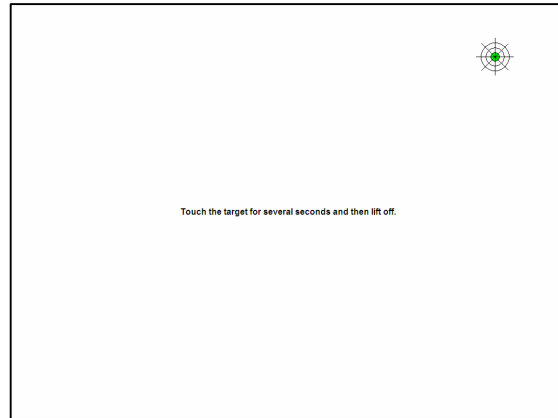

Step 1 – Start Touch Screen Control Panel

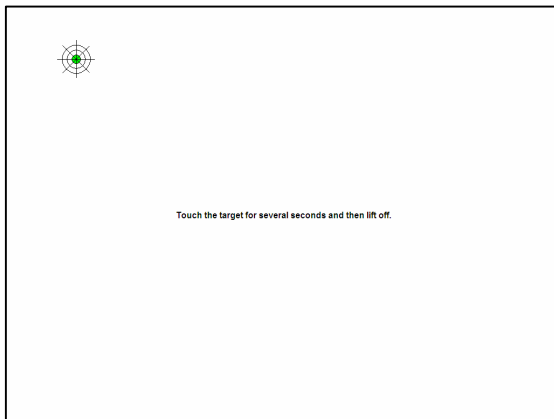

Step 2 - Press Calibrate Button
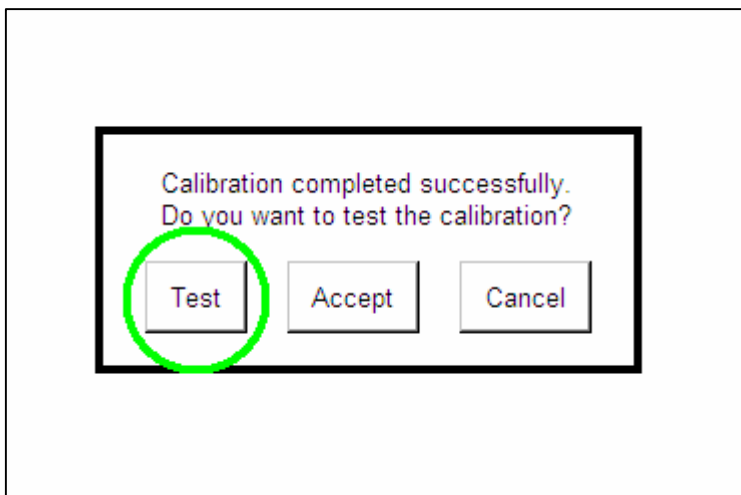
Touch the target for several seconds and then lift off.

Touch the target for several seconds and then lift off.

Step 3 – Press first green circle target by your finger

Step 4 – Press second green circle target by your finger

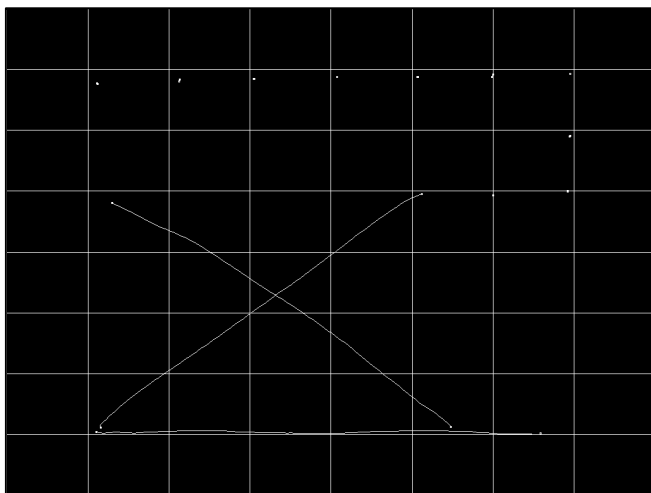Touch the target for several seconds and then lift off.

Step 5 – Press third green circle target by your finger

Calibration completed successfully.
Do you want to test the calibration?

Test   Accept   Cancel

Step 6 – Press Test Button

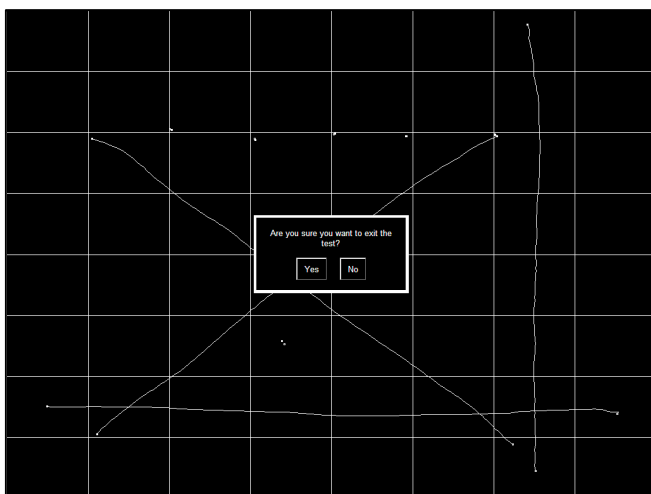Use this screen to test the accuracy of
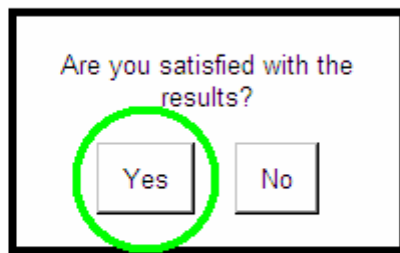the touch screen.
To exit, press ESCape or double-tap the
screen.
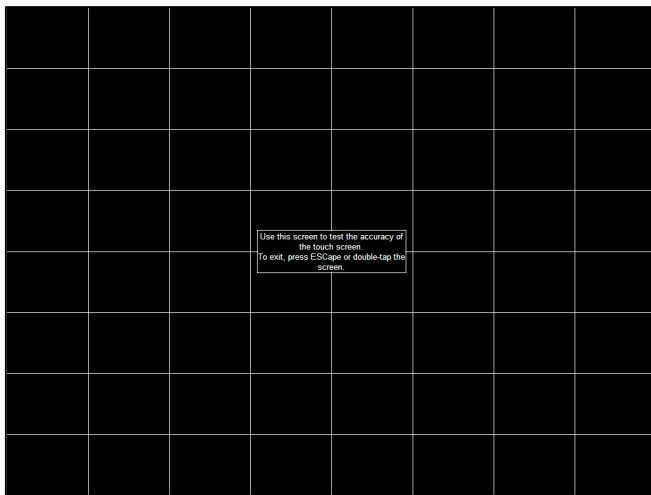
Step 7 – Testing screen appear

Step 8 – Test the settings and double-click
to end the test

Are you sure you want to exit the
test?

Yes   No

Step 9 – Are you sure you want to exit the
test?
Press YES button

Are you satisfied with the results?

Yes   No

Step 10 – Are you satisfied with the results ?
Press YES button !!!

Note:
If you press „No" button, settings could be incorrect under some circumstances!!!

MT 7 Software Control Panel, Version 7.12

Main | Touch Settings | Edge Adjustment | Tools |

Calibration

MT 7 provides a 3-point calibration for optimum accuracy for your touch display.

Calibrate

Support Information

Controller ID: USB00000000

Controller Type: EX II USB Capacitive

Firmware Version: 04.10

Touch Screen Status: OK
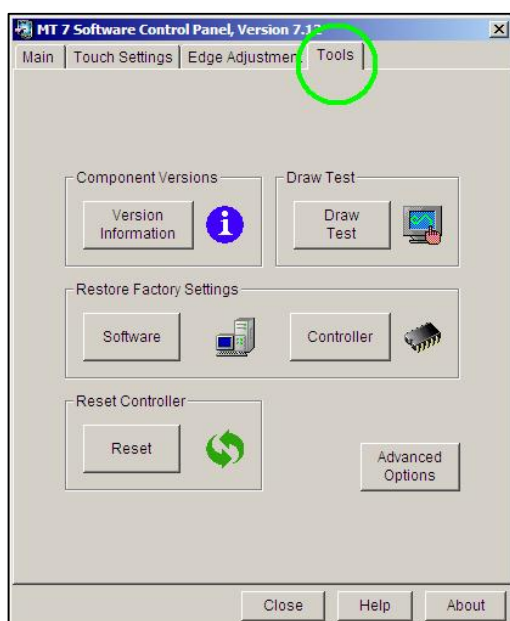
Close   Help   About
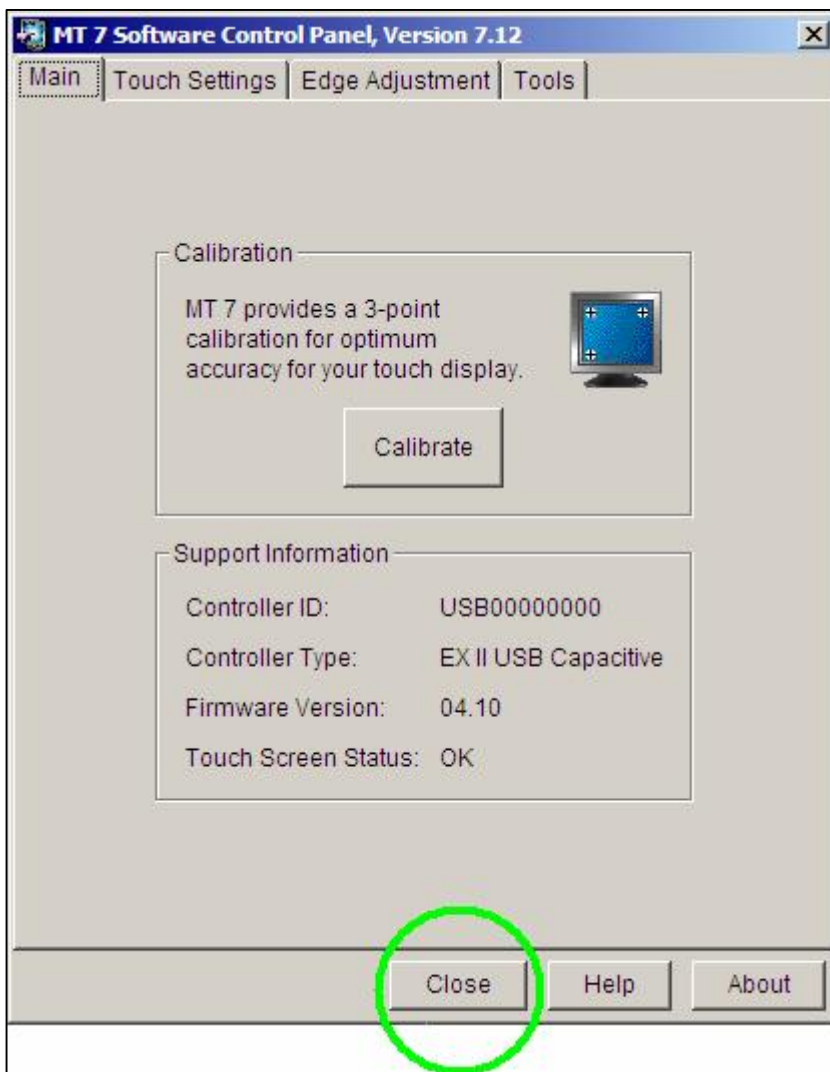
Step 11 – Close Control panel window. Setting is done
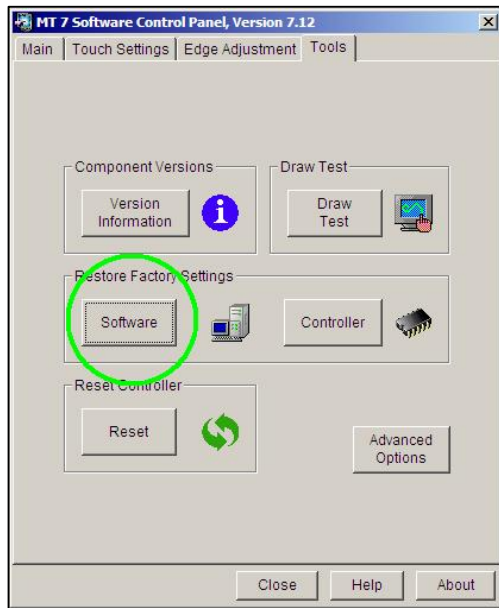
Appendix B - Troubleshooting

If problems with the touch screen settings occurred follow the procedure bellow. May be you will need to connect external keyboard and/or mouse to the control system .
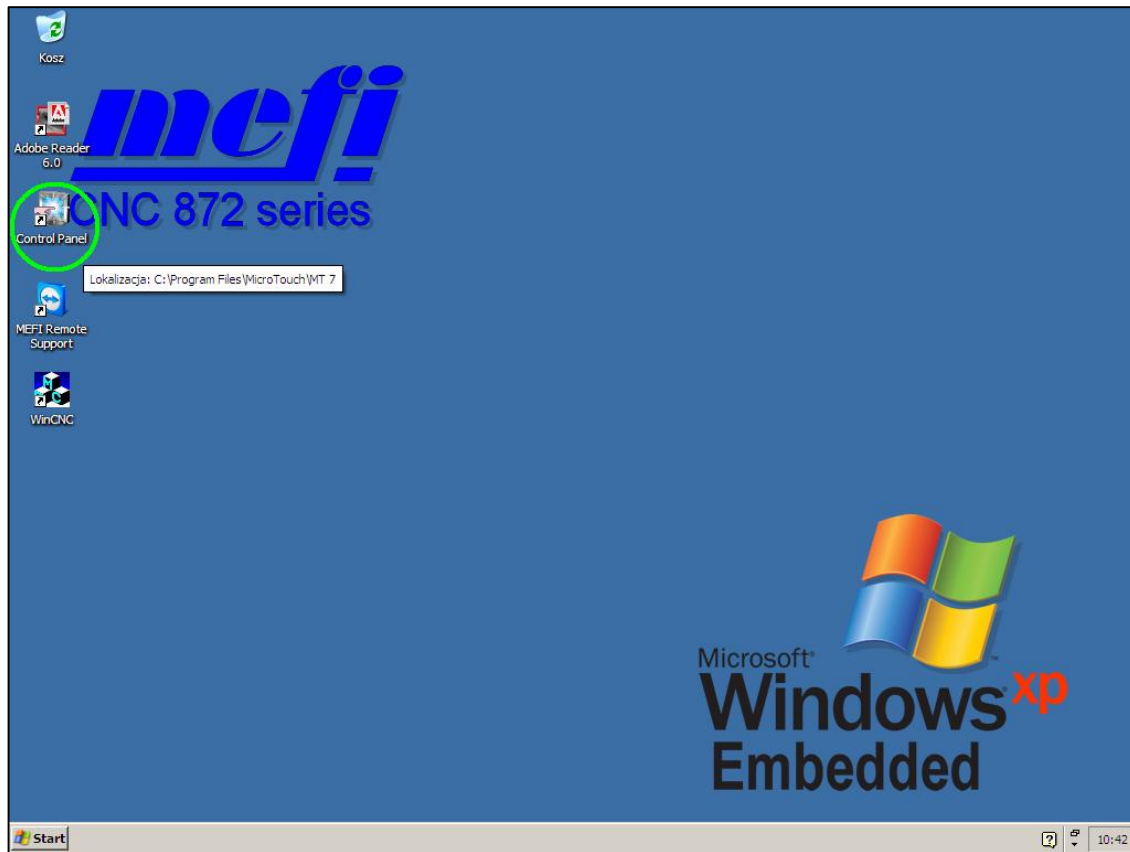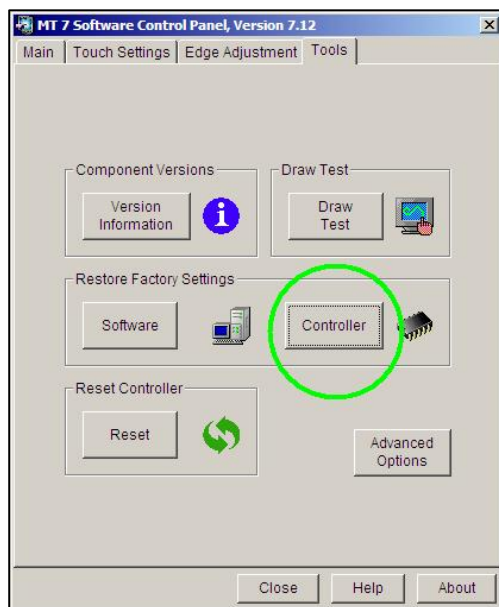
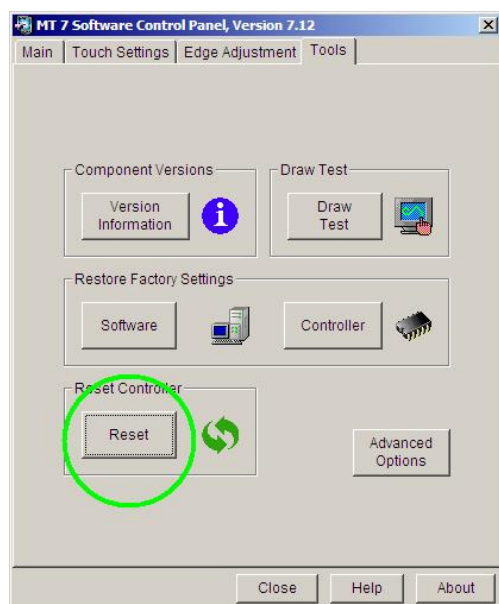

Step 1 - Start Control Panel
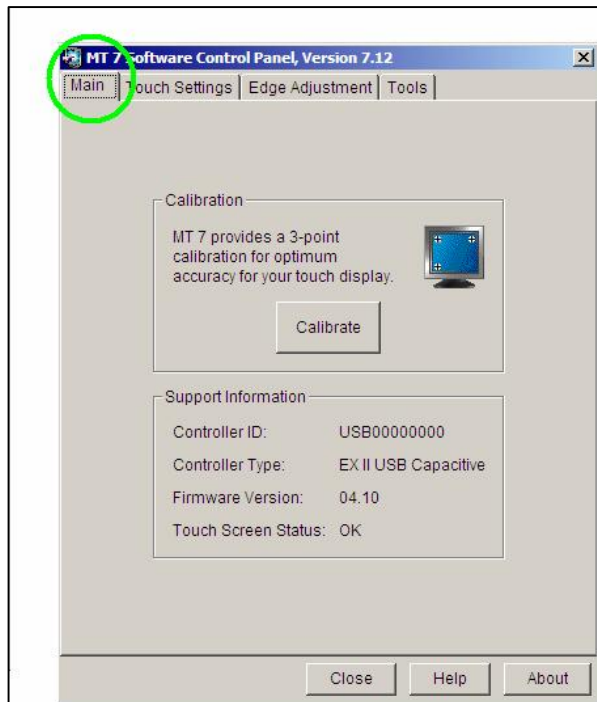

Step 2 – Select Tools

Step 3 – Press Software Button

Step 4 – Press Controller Button

Step 5 – Press Reset Button

Step 6 – Select Main and then continue from Appendix A - step 2